



DU	6/08/10	Rev A01	First Release
SB	8/11/10	Rev B01	Specified Alpha GRP110 NF 18/14 expando, added length tolerances, specified distance from J2/J3 to expando, added Note 4
DU	7/1/10	Rev B02	Clarify Glenair P/N to be 24 AWG, CCT P/N is unchanged and correct.
RC	8/2/10	Rev B03	Clarify notes for label placement.
SB	8/11/10	Rev B04	Clarify notes for label placement.
SB	8/25/10	Rev B05	Clarify cable length notes

Main 12V System Power Input

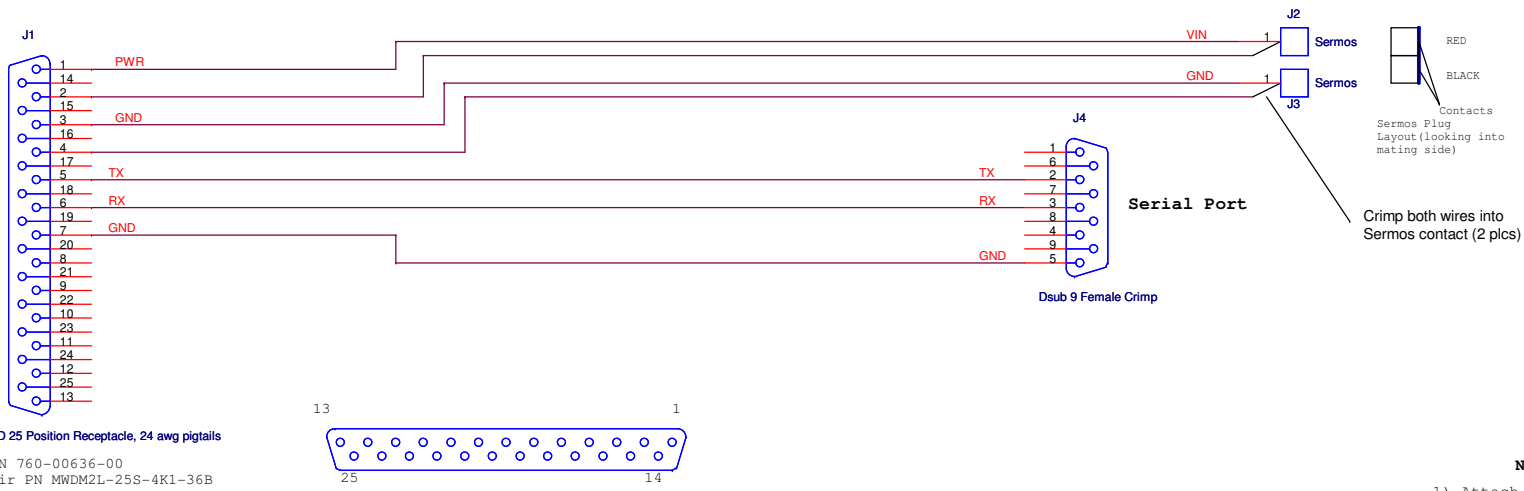

Notes:

- 1) Attach J2 and J3 together (mechanism is part of connectors) with contacts oriented as shown.
- 2) Place label on wire 2" from end of wire with the corresponding connector name for J2 & J3, and J4 (i.e. Serial Port).
- 3) Add label over expando-sleeving with "Gimbal Interface Cable", CCT Part Number, and Rev.
- 4) Make all labels type Tyco TTMS

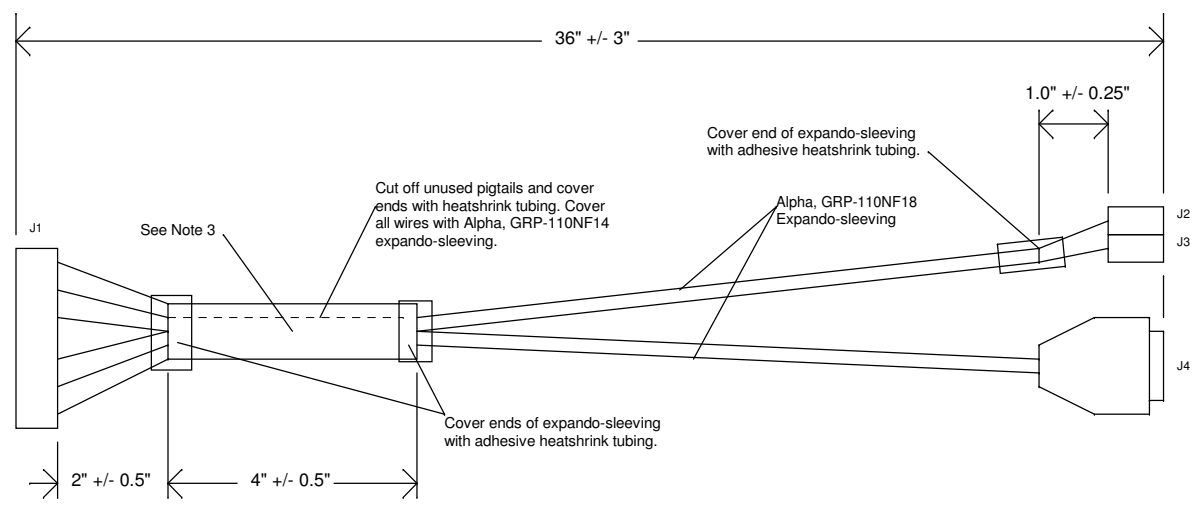

Connector Info:

- J2 - Anderson Power Products
Conn PN - 1327
Contact PN - 1332
- J3 - Anderson Power Products
Conn PN - 1327G6
Contact PN - 1332
- J4 - AMP
Conn PN - 205203-3
Socket PN - 66683-4
Hood PN - 5-748676-1

Cloud Cap Technology Inc		
Title Gimbal Interface Cable		
Size B	Document Number 500-01201-00	Rev B05
Date:	Wednesday, August 25, 2010	Sheet 1 of 1